Inter-Office Memo

GENERAL DYNAMICS

Land Systems Division P.O. Box 527, Warren, Michigan 48090

FILE 1420-03 problems

HJR/dr:85-136 2 December 1985

To: Site Supervisors


xc: F. Bryan, L. V. Clarkson, R. Wagner

Subject: Engine Thermal Damage

Enclosure: AVCO Incident Report

- Attached is an AVCO incident report that investigated an engine failure. The vehicle had just previously been through a "bird bath", and a later attempt to start the engine resulted in engine damage.
- Please advise personnel that when using the "bird bath", caution must be exercised so that water does not enter the air box.

Supervisor Field Activities

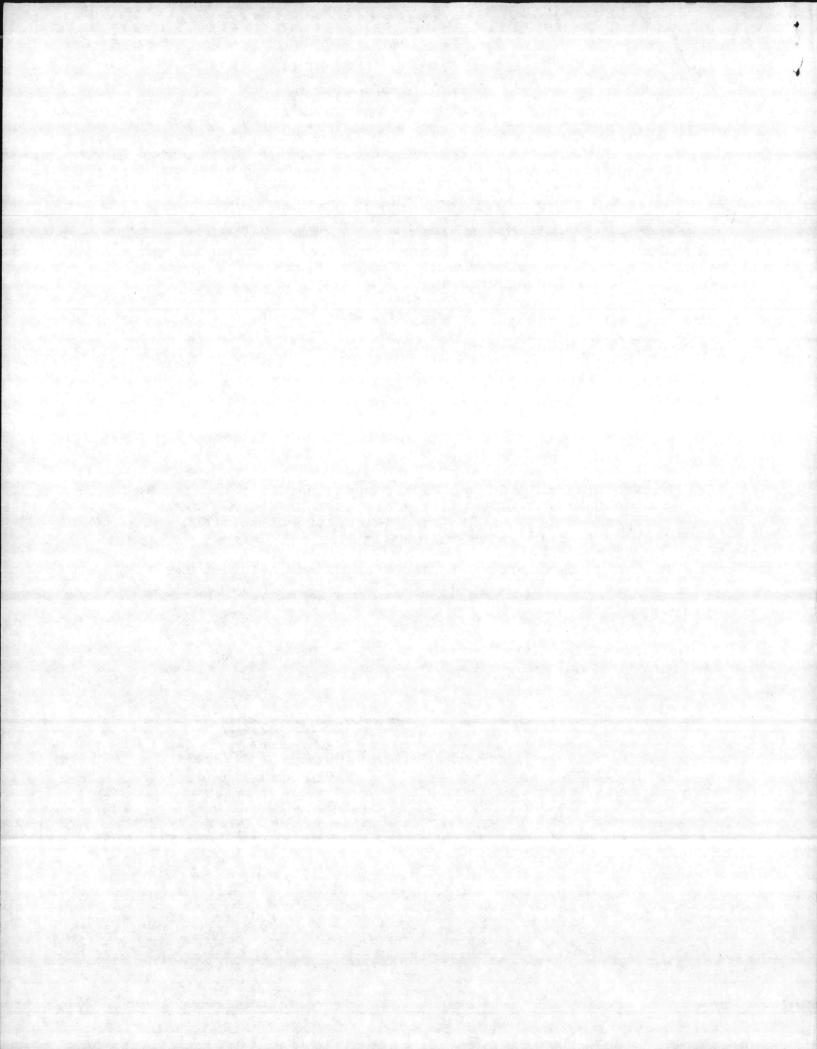

GENERAL DYNAMICS Land Systems Division

To: FO Chiefs

Date: 11/27

Subject:


Please tell our field sites to warn their counterparts about using these bird baths. Better not use them at all. If used, they must be used so as to avoid getting water over back deck.

J. J. McCuen

cc:	D.	Brown	Ν.	Hammes
	Ρ.	Erickson	R.	Hill
	Ε.	Ewing	J.	Ruma

FB LVC RJF DCF

WFB

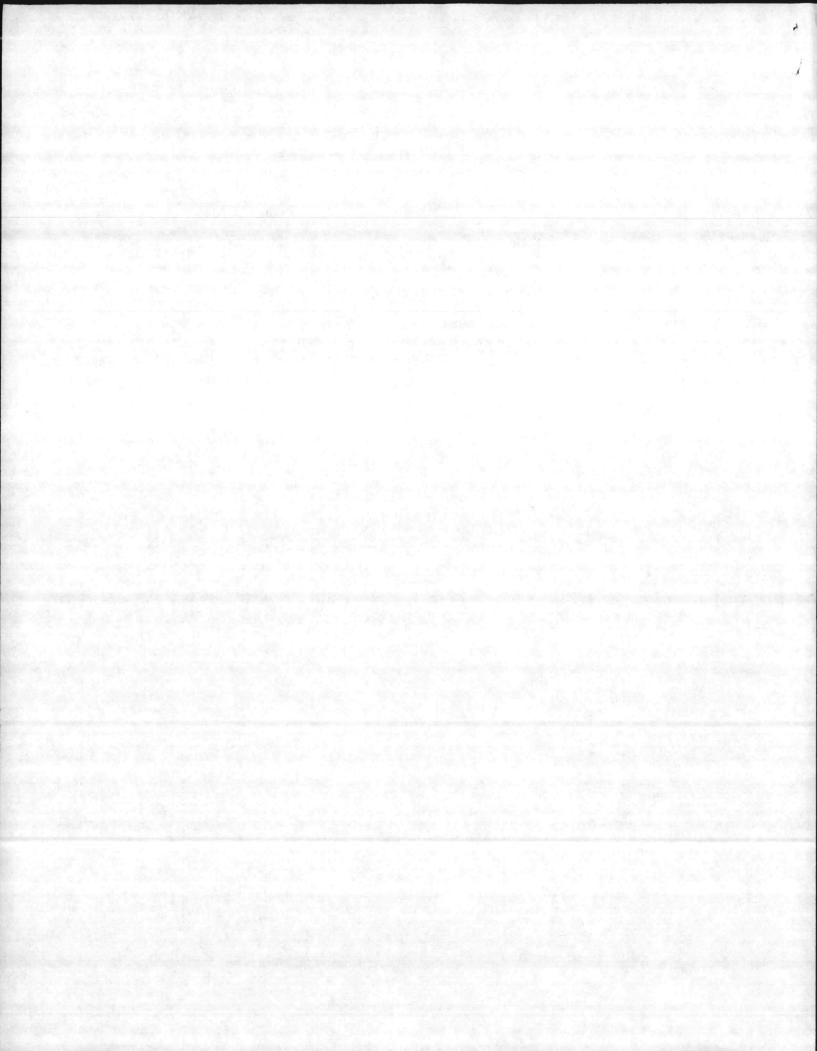

GENERAL DYNAMICS


Land Systems Division

26 November 1985

Frank:

Here is the report from Woody Griffin (AVCO) on vehicle L-0502. Dick does think that the team needs to go down and investigate. The engine has been packaged for shipment to the depot.

Hank

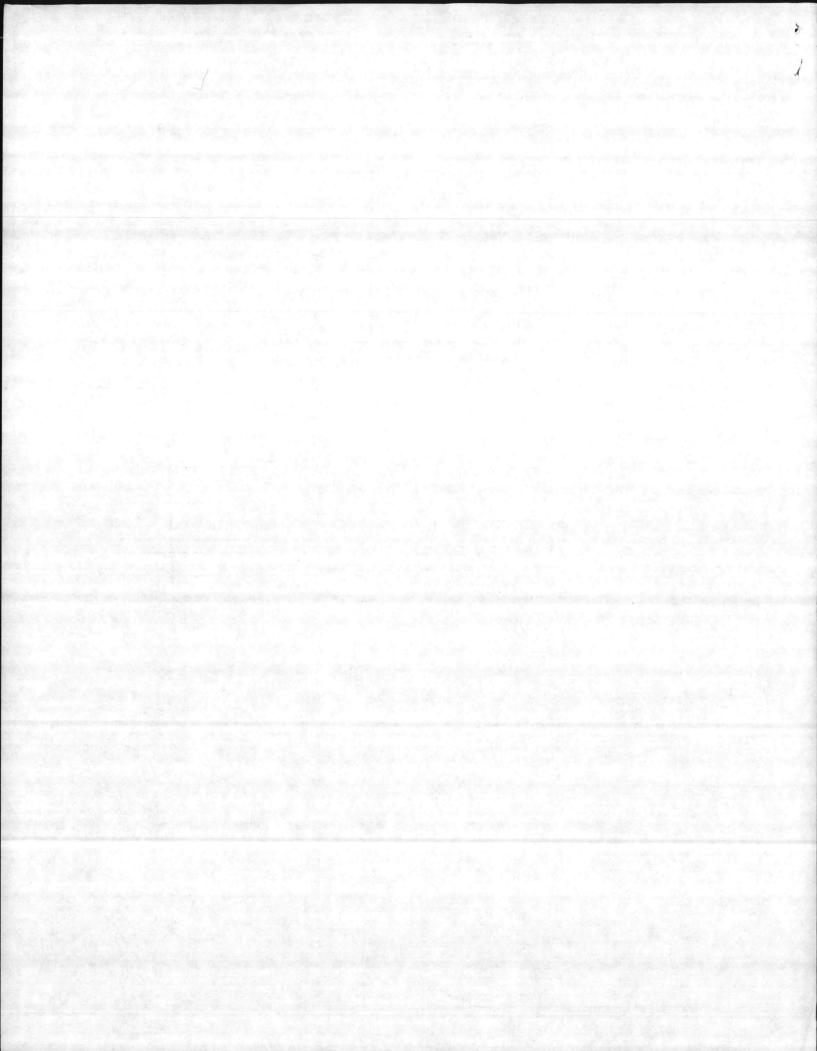

1 1 <th></th> <th>NG S/N</th> <th>INC. DT</th> <th></th> <th></th> <th></th> <th></th> <th>~!</th> <th></th> <th>1</th> <th>12111</th> <th>4.0000</th>		NG S/N	INC. DT					~!		1	12111	4.0000
Hold			I MO I DY	HAIN	VALUE I	1,6,			INCI	INT		TIN
International of the construction International of the construction International of the construction International of the construction International of the construction International of the construction International of the construction International of the construction International of the construction International of the construction International of the construction International of the construction International of the construction International of the construction International of the construction International of the construction International of the construction International of the construction International of the construction International of the construction International of the construction International of the construction International of the construction International of the construction International of the construction International of the construction International of the construction International of the construction of the construction International of the construction International of the construction International of the construction International of the construction International of the construction International of the construction International of the construction International of the construction International of the construction International of the construction International of the construction International of the construction	and the second s	11119	5 4 29	51, 1, 1		11.	EXH	UST	FIRE/SMOI	30		
Intraco	ISON MILES	IS LOC			H.C. ST	ARTS S			MILES STA	Silvesting		LIL
TH AGO TITN HT, GUT TH AG, GT TH AG TI AND THAN THAN THAN THAN THAN THAN THAN THAN		2	L-050	2		12	- 2010 J				ON MISC. C	DDE ILA
The Number of the second sec	ITR REC DT I ITR #	T. DET ITT			11.11		111	1	1111L			
Indice Decision Valuation CONFIGURATION INC. SCCURATO DURING INC. SPECT ON OPER. APPAIR ACTION REFAIR ACTION REFAIR ACTION INC. SCCURATO DURING INC. SPECT ON OPER. APPAIR ACTION REFAIR ACTION REFAIR ACTION INC. SCCURATO DURING INTRODUCTION OF THE CONTROL		HO DV VA	NO TOV	a ran	INO.		TR NO		EPR NO	Station of the	OTHER	
Indice Decision Valuation CONFIGURATION INC. SCCURATO DURING INC. SPECT ON OPER. APPAIR ACTION REFAIR ACTION REFAIR ACTION INC. SCCURATO DURING INC. SPECT ON OPER. APPAIR ACTION REFAIR ACTION REFAIR ACTION INC. SCCURATO DURING INTRODUCTION OF THE CONTROL				4 :			(Really)	1		a day in		and the second second
Hereine Decknow JOS AR PL. Hood, TX Decknow Decknow NEC. SOCUMAR DURING INC. SPEECT ON GREAT TREAD OF ACTION TREAD OF A	ANALYSIE NO.			ACT A FOR		N N N COL			111111	1111	LULI	
INC. OCCUDANT. JOY AR F2. Mod. 71 INC. OCCUDANT. INC. EFFECT ON CORPT. INC. OCCUDANT. OD STACT. INC. OF CLASS. OF STACT. INC. OF CLASS. OF STACT. INC. OF STACT. OF STACT. INC. OF STACT. OF STACT. INC. OF STACT. OF STACT.	11 4					V	ARIATIO	ON:		CONFIGU	RATION	Sec. And
The same and the second part of the sec	111111111	LOCATH	ON: 3/	07 AR F	Hood	TX	•		Securement of the second	al same and		States and the states
THE ADDRESS OF A DECK OF A	INC. OCCURRED	DURING	INC.	FFECT ON	OPER.		REDAI	DAG	FIGH	-	-	
Berger Discrete Construction of the second sector construction of the			A STATISTICS OF STATISTICS			-						
Barrow Description	RE-OP		MISSION DE	LAY		LA ENGA	EM		VENC NO D			
Community of the sector book of the sector backward and the sector back of th	EST-OP					PRE-O	-					
ENGINE AND CALE AND CONTRACTOR Contract Contr	IORMAL-OP D MODIE	DCATION O					NHUAL IN					
ENGINE PROBLEM DETERMINATION EVAILATION REQUIRE PROBLEM DETERMINATION REQUIRE MAINTENANCE REQUIRE MAINTENANCE REQUIRE MAINTENANCE REQUIRE MAINTENANCE REQUIRE MAINTENANCE REQUIRE MAINTENANCE COMBANE AND TO SALES AND TO S	HUTDOWN						CATION					
BATTLATON 0 0 INNOUND 0										and the second		
PROTECTION Description				State State State					REQUIRI	D		
Generation Bat Sector Bat Sector <td></td> <td>ENGINE</td> <td>0</td> <td></td> <td></td> <td>CORROS</td> <td>DNG</td> <td>2 F</td> <td>OPERATOR/CREW</td> <td></td> <td></td> <td></td>		ENGINE	0			CORROS	DNG	2 F	OPERATOR/CREW			
PARTO DARLESSON CAUSE GAVY O OTHER O Description D Description D <thd< th=""> D D <thd< th=""> <thd< td=""><td></td><td></td><td></td><td>ADJ. ONLY .</td><td>0</td><td>EROSIO</td><td></td><td></td><td></td><td></td><td>ORGAMZATIC</td><td>D</td></thd<></thd<></thd<>				ADJ. ONLY .	0	EROSIO					ORGAMZATIC	D
PARTC PARTNAME PARTNAME PARTNAME PARC Rest B3559 12266000 Engine Image Image PARTNERN PARTNAME PARTNAME PARC Image Image PARTOBECREANCY PARTNAME PARTNAME PARTNAME PARTOBECREANCY PARTNAME PARTNAME PARTOBECREANCY PARTNAME PARTOBECREANCY PARTNAME PARTNAME PARTOBECREANCY PARTNAME PARTNAME PARTOBECREANCY PARTNAME PARTNAME PARTNAME PARTNAME PARTNAME PARTOBECREANCY PARTNAME PART		ENG. DENGN		CAUSE ONLY		OTHER			DIRECT			
A 88559 12286000 Engine PARTNAME PAC IC PARTORSERANCY PARTHR PARTHR PARTNAME PAC IC I Thermal Damage PARTNAME PARTNAME PAC IC I PARTORSERANCY PARTHR PARTNAME PARTNAME MODULESN MODULESN PARTORSERANCY PARTHR PARTNAME PARTNAME FAC IC I PARTORSERANCY PARTHR PARTNAME PARTNAME MODULESN MODULESN MOD.C I PARTORSERANCY PARTNAMER PARTNAME PARTNAME PARTNAME MODULESN MOD.C I PARTORSERANCY PARTNUMBER PARTNAME PARTNAME FAC IC I I PARTORSERANCY PARTNAMER PARTNAME PARTNAME FAC IC I I <td>PARTE</td> <td></td> <td>-</td> <td></td> <td>-</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td>	PARTE		-		-							
PART DISCREPANCY PART HR PART MR PART MARKE PART MARKE <td></td> <td></td> <td>1 4 9 9 4</td> <td>PARTNU</td> <td>MBER</td> <td></td> <td>PA</td> <td>RTNA</td> <td>ME</td> <td>CC</td> <td>Sec. 1</td> <td>•</td>			1 4 9 9 4	PARTNU	MBER		PA	RTNA	ME	CC	Sec. 1	•
PARTORICREANCY PARTHR PARTMI Rest account of the second seco	20000		1228	00000		E	ngine		attention and	Π		
Thermal Damage MODULE SN M	PART DIS	CREPANCY		PARTUR	PARTA			dist.				7
PARTC PARTON PARTNAMER PARTNAME PARTNAME PARTNAME PART DISCREPANCY PARTNAME			1.300		CONTR	Statement in the statement when			MODUL	5/N	MOD. C	
PART DISCREPANCY PART H PART MI RISIS CAC DISIS MODULE SAN MOD.C T PART DISCREPANCY PART H PART MI RISIS CAC DISIS MODULE SAN MOD.C T PART DISCREPANCY PART H PART MI RISIS CAC DISIS MODULE SAN MOD.C T PART DISCREPANCY PART H PART MI RISIS CAC DISIS MODULE SAN MOD.C T PART DISCREPANCY PART H PART MI RISIS CAC DISIS MODULE SAN MOD.C T PART DISCREPANCY PART H PART MI RISIS CAC DISIS MODULE SAN MOD.C T PART DISCREPANCY PART H PART MI RISIS CAC DISIS MODULE SAN MOD.C T PART DISCREPANCY PART H PART MI RISIS CAC DISIS MODULE SAN MOD.C T PART DISCREPANCY PART H PART MI RISIS CAC DISIS MODULE SAN MOD.C T PART DISCREPANCY PART H PART MI RISIS CAC DISIS MODULE SAN MOD.C T PART DISCREPANCY PART H PART MI RISIS CAC DISIS MODULE SAN MOD.C T PART DISCREPANCY PART H PART MI RISIS CAC DISIS MODULE SAN MOD.C T PART DISCREPANCY PART H PART MI RISIS CAC DISIS MODULE SAN MOD.C T PART DISCREPANCY PART H PART MI RISIS CAC DISIS MODULE SAN MOD			1.1.1	Lui	1111	. 3	1	DH HC				1
PART Discrepancy PART HR PART MI R S S CAC Dis S MODULE SN MOD. C PART C. PART MANAGE PART MARKE PART NAME PMC C S PART DISCREPANCY PART MI PART MI PART MAKE PMC C S PART DISCREPANCY PART MI PART MI PART MAKE PMC C S PART DISCREPANCY PART MI PART MI PART S S CAC DIS S MODULE SN MOD. C PART DISCREPANCY PART MIMBER PART MAKE PART MAKE PMC C S PART DISCREPANCY PART MIMBER PART MAKE PART MAKE FMC C S PART DISCREPANCY PART MIMBER PART MAKE PART MAKE FMC C S PART DISCREPANCY PART MAKE PART MAKE FMC C S S PART DISCREPANCY PART MAKE PART MAKE FMC C S S PART DISCREPANCY PART MAKE PART MAKE FMC C S S PART DISCREPANCY PART MAKE PART MAKE S S S S S S S S S <t< td=""><td>PART C. P</td><td>ANT S/N</td><td>in a let</td><td>PARTNU</td><td>MBER</td><td></td><td>PA</td><td>RTNA</td><td>ME</td><td>CCI</td><td></td><td>-</td></t<>	PART C. P	ANT S/N	in a let	PARTNU	MBER		PA	RTNA	ME	CCI		-
PARTC. PARTEN PARTNUMBER PARTNAME FAC DISS MODULESA MOD. C 1. PART DISCREPANCY PARTNAM PARTNAM RISECAC DISS MODULESA MOD. C 7 PART DISCREPANCY PARTNAME PARTNAME FAC DISS MODULESA MOD. C 7 PART DISCREPANCY PARTNAME PARTNAME FAC DISS MODULESA MOD. C 7 PART DISCREPANCY PARTNAME PARTNAME FAC DISS MODULESA MOD. C 7 PART DISCREPANCY PARTNAME PARTNAME FAC DISS MODULESA MOD. C 7 PART SAN PARTNAME PARTNAME FAC DISS MODULESA MOD. C 7 PART SAN PARTNAME PARTNAME PARTNAME FAC DISS MODULESA MOD. C 7 PART SAN PARTNAME PARTNAME PARTNAME FAC DISS MODULESA MOD. C 7 PART SAN PARTNAME PARTNAME PARTNAME A SOURCE ISLAMAND D 7 TECH REP'S NAME Y.E.C. CTIFTIN DATE OF REPORT ZO NOV 185 LOCATION FL. MOD. T 7 MARKS Vehicle had just previously been through the "hird bath" and then parked on the sh Tack. Later, when an attempted start was made the vehicle shorted th the same results (two gas over temp aborts). Troubleshooting revealed an accumulation water in the planum chamber and the Ves-Pace wars also wat. The HP bleed tube was ware soving the combustor can. minor thermal damage and was beginning to curl. The # 5 bearing sovenge line inside the rear module was badly burned at the bottom. a scould that hermal damage and was beginning to curl. The # 5 bearing sovenge line inside the rear module was badly burned at the bottom. a scould SHOTS. Other Module 851075. ACB 851066.							100					1
PART C. PARTEN PARTNUMBER PARTNAME FAC DIS S MODULE SAM MOD. C T PART DISCREPANCY PARTNAM PARTNAM RISIS CAC DIS S MODULE SAM MOD. C T PART DISCREPANCY PARTNAME PARTNAME FAC DIS S MODULE SAM MOD. C T PART DISCREPANCY PARTNAME PARTNAME FAC DIS S MODULE SAM MOD. C T PART DISCREPANCY PARTNAME PARTNAME FAC DIS S MODULE SAM MOD. C T PART DISCREPANCY PARTNAME PARTNAME FAC DIS S MODULE SAM MOD. C T PART SAM PARTNAME PARTNAME FAC DIS S MODULE SAM MOD. C T PART SAM PARTNAME PARTNAME FAC DIS S MODULE SAM MOD. C T PART SAM PARTNAME PARTNAME AS S S S S S S S S S S S S S S S S S S	PART DIR	CREPANCY		1 BADTUC	1	+ 1=1=1-	111	11	Juli			
PARTC. PARTON PARTNUMBER PARTNAME PACTA AND PARTNAME PACTORS MODULE SN SOUTHAND THE STATE STAT				TARI HR	PARTA			DIS	MODULE	S/N	MOD. C	T .:
PARTC. PARTON PARTNUMBER PARTNAME PACTA AND PARTNAME PACTORS MODULE SN SOUTHAND THE STATE STAT			1111	Lui		. 3					Street of	
PART DISCREPANCY PARTHE PARTHE RESISTER DISCREPANCY PARTHE PARTHE RESISTER CAC DISTS MODULES/N MOD.C PART DISCREPANCY PARTHE PARTHE RESISTER PARTHER RESISTER CONFIRMED DIVES DE PART DISCREPANCY PARTHE PARTHER RESISTER CONSISTER MODULES/N MOD.C PART DISCREPANCY PARTHE PARTHER RESISTER CONSISTER MODULES/N MOD.C PART DISCREPANCY PARTHER PARTHER RESISTER CONSISTER MODULES/N MODUL	PARTC. PA	ART S/N		No. of Concession, Name of Concession, Name of Street, or other Designation, or other De	MBER			ATNA	ME		Lul	-
PARTONCREPANCY PARTNUMBER PARTNUMBER PARTNAME FMC C PARTONCREPANCY PARTNUMBER PARTNAME PARTNAME FMC C PARTONCREPANCY PARTNUMBER PARTNAME ABOVE INCIDENT CONFIRMED DIVES OF PARTONCREPANCY PARTNUMBER PARTNAME ABOVE INCIDENT CONFIRMED DIVES OF PARTONCREPANCY PARTNUMBER PARTNAME ABOVE INCIDENT CONFIRMED DIVES OF PARTONCREPANCY PARTNUMBER PARTNAME ABOVE INCIDENT CONFIRMED DIVES OF PARTON PARTNUMBER PARTNAME ABOVE INCIDENT CONFIRMED DIVES OF TECH REPS NAME Y.E.C. GRISTIN DATE OF REPORT ZO NOV B5 LOCATION PL. HANDYE ZOM AND D TECH REPS NAME Y.E.C. GRISTIN DATE OF REPORT ZO NOV B5 LOCATION PL. HANDYE ZOM AND D TECH REPS NAME Y.E.C. GRISTIN DATE OF REPORT ZO NOV B5 LOCATION PL. HANDYE ZOM AND D TECH REPS NAME Y.E.C. GRISTIN DATE OF REPORT ZO NOV B5 LOCATION PL. HANDYE ZOM AND D TECH REPS NAME Y.E.C. GRISTIN DATE OF REPORT ZO NOV B5 LOCATION PL. HANDYE ZOM AND D TECH REPS NAME Y.E.C. GRISTIN DATE OF REPORT ZO NOV B5 LOCATION PL. HANDYE ZOM AND D TECH REPS NAME Y.E.C. GRISTIN DATE OF REPORT ZO NOV B5 LOCATION PL. HANDYE ZOM AND D TECH REPS NAME Y.E.C. GRISTIN DATE OF REPORT ZO NOV B5 LOCATION PL. HANDYE ZOM AND D TECH REPS NAME Y.E.C. GRISTIN DATE OF REPORT ZO NOV B5 LOCATION PL. HANDYE ZOM AND D TECH REPS NAME Y.E.C. GRISTING NAMENKS VEHICLE HAD THE ADDRESS OF TEMP ADOTING THE MED DATE OF THE HIS DATE OF THE NAMES VEHICLE HAD THE SAME AND THE ADDRESS OF THE ADOT OF THE ADDRESS OF THE			Self- 9	Sec. Sec. Alt			FA		PME PM			
PARTOL PARTS/N PARTNUMBER PARTNUMBER PARTNUMBER PARTNAME FMC C PARTOLICREPANCY PARTNUMBER PARTNUMBER PARTNAME PARTNAME FMC C PARTOLICREPANCY PARTNUMBER PARTNAME ABOVE INCIDENT CONFIRMED DIVES OF PARTS/N PARTNUMBER PARTNAME ABOVE INCIDENT CONFIRMED DIVES OF PARTS/N PARTNUMBER PARTNAME ABOVE INCIDENT CONFIRMED DIVES OF SOURCE ISL HANDXE ZOH AND D TECH REPS NAME Y.E.C. GRISTIN DATE OF REPORT ZO NOV B5 LOCATION PL. HOND, TY MARKS Vehicle had just previously been through the "hird bath" and then parked on the ab rack. Later, when an attempted start was made the vehicle emitted large amounts of oks and flames out the exhaust. A restart attempt was made and the vehicle aborted th the same results (two gas over temp aborts). Troubleshooting revealed an accumulating water in the planum chamber and the Vese-Pace were also wet. The HP bleed tube was we th oil as was the exhaust and the engine intaks. All components rotated freely. After moving the combustor can, minor thermal damage and was beginning to ourl. The # 5 bearing a scouper drain also had thermal damage and was beginning to ourl. The # 5 bearing avenge line inside the rear module was badly burned at the bottom. a scuper drain also had thermes damage and was beginning to ourl. The # 5 bearing avenge line inside the rear module was badly burned at the bottom. ACTION Strument Module SHOST. ACB 851068.		1111	1.1.1	+++++	111				1111			
PARTO: PARTON PARTNUMBER PARTNUMBER PARTNAME FMC C PARTO: CREPANCY PARTNA PARTNI RISS CAC DISS MODULES/N MOD.C PARTO: CREPANCY PARTNA PARTNI RISS CAC DISS MODULES/N MOD.C PARTO: CREPANCY PARTNAME PARTNAME ABOVE INCIDENT CONFIRMED DIVES DIVE PARTO: CREPANCY PARTNAME PARTNAME ABOVE INCIDENT CONFIRMED DIVES DIVE PARTO: CREPANCY PARTNAME PARTNAME ABOVE INCIDENT CONFIRMED DIVES DIVE PARTS/N PARTNUMBER PARTNAME ABOVE INCIDENT CONFIRMED DIVES DIVES DIVE PARTS/N PARTNUMBER PARTNAME ABOVE INCIDENT CONFIRMED DIVES DIVES DIVE PARTS/N PARTNUMBER PARTNAME ABOVE INCIDENT CONFIRMED DIVES	PART DISC	GREPANCY		PARTHR	PARTN	I RSS	CAC	DIS	MODULE	S/N	MOD. C	Ť
PARTC PARTON PARTNUMBER PARTNAME FMC C T PARTOSCREPANCY PARTNAME PARTNAME RSS CAC DISS MODULES/N MOD.C T PARTOSCREPANCY PARTNAME PARTNAME RSS CAC DISS MODULES/N MOD.C T PARTOSCREPANCY PARTNAME PARTNAME ASSOCREPANCE CONFIRMED FORES OF PARTOSCREPANCY PARTNAME PARTNAME ASSOCREPANCE CONFIRMED FORES OF SOURCE IS HANDING Zod HANDIE TECH REP'S NAME Y.E.C. Griffin DATE OF REPORT NO. 432-115 PAGE 1 OF J MARKS Vehicle had just previously been through the "hird bath" and then parked on the ah rack. Later, when an attempted start was made the vehicle emitted large amounts of Oke and flames out the exhaust. A restart attempt was made and the vehicle aborted th the same results (two gas over temp aborts). Troubleshooting revealed an accumulat: water in the planum chamber and the Vese-Pace wars also wat. The HP bleed tube was we th oil as was the exhaust and the engine intake. All components rotated freely. After moving the combustor can. minor thermal damage was noted around the last two cooling rise a scroll also had thermal damage and was beginning to curl. The # 5 bearing a vesible thermacouple harmesses ware also burned. Engine II be evacuated to the depot. The HNB and ECU will be ave Module 85H077. Forward Module 851068.				13. 25		3		1				
PARTOSCREPANCY PARTHR PARTMI RISIS CAC DISIS MODULES/N MOD.C T PARTOSCREPANCY PARTHR PARTMI RISIS CAC DISIS MODULES/N MOD.C T TECH REP'S NAME W.E.C. Griffin DATE OF REPORT 20 NOV '85 LOCATION FTL. Hod, TT LOCATION FTL. Hod, TT REPORT NO. 432-115 PAGE 1 OF J REPORT NO. 432-115 PAGE 1 OF J REPORT NO. 432-115 PAGE 1 OF J REPORT NO. 432-115 PAGE 1 OF J MARKS Vehicle had just previously been through the "hird bath" and then parked on the DOCATION FTL. Hod, TT REPORT NO. 432-115 PAGE 1 OF J REPORT NO. 432-115 PAGE 1 OF J REPORT NO. 432-115 PAGE 1 OF J MARKS Vehicle had just previously been through the "hird bath" and then parked on the DOCATION FTL. Hod, TT REPORT NO. 432-115 PAGE 1 OF J REPORT NO. 432-115 PAGE 1	PARTC. PA	ART S/N		the second s	ARE			1	11111		LUL .	-
PART S/N PART NUMBER PART NAME ABOVE INCIDENT CONFIRMED EXCESSION PART NUMBER PART NAME ABOVE INCIDENT CONFIRMED EXCESSION SOURCE 1st HANDXE 2nd HAND D TECH REP'S NAME Y.E.C. Griffin DATE OF REPORT NO. 432-115 PAGE 1 OF J MARKS Vehicle had just previously been through the "hird bath" and then parked on the backs and flames out the exhaust. A restart attempt was made and the vehicle aborted th the same results (two gas over temp aborts). Troubleshooting revealed an accumulat: water in the planum chamber and the venice intake. All components rotated freely. After moving the combustor can, minor thermal damage was noted around the last two cooling ri- a scroll also had thermal damage at the top of the scroll at the 6 o'clock position. e visible thermocoule harnesses were also burned. Engine 11 be evacuated to the depot. The HNB and ECU will be avenge line inside the rear module making up this engine area ar Module 85H097. Forward Modules SU075, ACB 851068.		season and the					PA	ATNA	ME EM	C C		
PART S/N PART NUMBER PART NAME ABOVE INCIDENT CONFIRMED EXCESSION PART NUMBER PART NAME ABOVE INCIDENT CONFIRMED EXCESSION SOURCE 1st HANDXE 2nd HAND D TECH REP'S NAME Y.E.C. Griffin DATE OF REPORT NO. 432-115 PAGE 1 OF J MARKS Vehicle had just previously been through the "hird bath" and then parked on the backs and flames out the exhaust. A restart attempt was made and the vehicle aborted th the same results (two gas over temp aborts). Troubleshooting revealed an accumulat: water in the planum chamber and the venice intake. All components rotated freely. After moving the combustor can, minor thermal damage was noted around the last two cooling ri- a scroll also had thermal damage at the top of the scroll at the 6 o'clock position. e visible thermocoule harnesses were also burned. Engine 11 be evacuated to the depot. The HNB and ECU will be avenge line inside the rear module making up this engine area ar Module 85H097. Forward Modules SU075, ACB 851068.	<u></u>	LI LI	Lui	LLLL.								1
PART S/N PART NUMBER PART NAME ABOVE INCIDENT CONFIRMED EXCESSION PART NUMBER PART NAME ABOVE INCIDENT CONFIRMED EXCESSION SOURCE 1st HANDXE 2nd HAND D TECH REP'S NAME Y.E.C. Griffin DATE OF REPORT NO. 432-115 PAGE 1 OF J MARKS Vehicle had just previously been through the "hird bath" and then parked on the backs and flames out the exhaust. A restart attempt was made and the vehicle aborted th the same results (two gas over temp aborts). Troubleshooting revealed an accumulat: water in the planum chamber and the venice intake. All components rotated freely. After moving the combustor can, minor thermal damage was noted around the last two cooling ri- a scroll also had thermal damage at the top of the scroll at the 6 o'clock position. e visible thermocoule harnesses were also burned. Engine 11 be evacuated to the depot. The HNB and ECU will be avenge line inside the rear module making up this engine area ar Module 85H097. Forward Modules SU075, ACB 851068.	PART DISC	CREPANCY	in a star	PARTHR	PARTM	RSS	CAC	DIS	MODULE	S/N	HOD CI	Ŧ
PART N/N PART NUMBER PART NAME ABOVE INCIDENT CONFIRMED ENJES OF ABOVE INCIDENT CONFIRMED ENJES OF SOURCE ISTHANDING 2nd HAND D TECH REP'S NAME W.E.C. Griffin DATE OF REPORT 26 Nov 185 LOCATION Ft. Hood, TT REPORT NO. 432-115 PAGE 1 OF J MARKS Vehicle had just previously been through the "bird bath" and then parked on the ab rack. Later, when an attempted start was made the vehicle emitted large amounts of oke and flames out the exhaust. A restart attempt was made and the vehicle aborted th the same results (two gas over temp aborts). Troubleshooting revealed an accumulat: water in the planum chamber and the Vee-Pace were also wet. The HP bleed tube was we th oil as was the exhaust and the engine intake. All components rotated freely. After moving the combustor can. minor thermal damage was noted around the last two cooling ri- a scroll also had thermal damage at the top of the scroll at the 6 o'clock position. a scupper drain also had thermal damage and was beginning to curl. The # 5 bearing avenge line inside the rear module was badly burned at the bottom. a visible thermocouple harnesses were also burned. Engine It be evacuated to the depot. The HNB and ECU will be ar Module 85H097. Forward Module 851075. ACB 851068.						Salary Course Manager Manager			I. I		mou. c	
ABOVE INCIDENT CONFIRMED EXTENDED ABOVE INCIDENT CONFIRMED EXTENDED SOURCE 1st HANDXE 2nd HAND E SOURCE 1st HANDXE 2nd HAND E TECH REP'S NAME W.E.C. Griffin DATE OF REPORT 26 Nov 'BS LOCATION Ft. Hood, TT REPORT NO. 432-115 PAGE 1 OF REPORT NO. 432-115 PAGE 1 OF REPORT NO. 432-115 PAGE 1 OF A resk. Later, when an attempted start was made the vehicle emitted large amounts of oke and flames out the exhaust. A restart attempt was made and the vehicle aborted th the same results (two gas over temp aborts). Troubleshooting revealed an accumulat water in the planum chamber and the Ven-Pace were also wat. The HP bleed tube was we th oil as was the exhaust and the engine intake. All components rotated freely. After moving the combustor can, minor thermal damage was noted around the last two cooling re- a scroll also had thermal damage at the top of the scroll at the 6 o'clock position. a scouper drain also had thermal damage and was beginning to curl. The # 5 bearing avenge line inside the rear module was badly burned at the bottom. a visible thermocouple harnesses were also burned. Engine ar Module 85H097, Forward Module 851075, ACB 851068.	PART S/N	BA			444			14	Harris .			4
Source in the planum chamber and the engine intake. All components rotated freely. After noving the combustor can. minor thermal damage was noted around the last two cooling ri- a scouper drain also had thermal damage and was beginning to curl. The # 5 bearing avenge line inside the rear module was badly burned at the bottom. a visible thermocouple harnesses were also burned. Engine avenge line inside the rear modules making up this and EDU will be avenge line inside the depot. The HNB and EDU will be avenge line inside the depot. The HNB and EDU will be avenge line inside the depot. The HNB and EDU will be avenge line inside the depot. The HNB and EDU will be avenge line inside the depot. The HNB and EDU will be avenge line inside the depot. The HNB and EDU will be avenge line inside the depot. The HNB and EDU will be avenge SH097. Forward Module 850075. AGB 851068.		FAI	NUMB	57	PA	HI NAM		11	ABOVEINC	IDENT CO	ONFIRMED	
TECH REP'S NAME W.E.C. Griffin DATE OF REPORT 25 Nov '85 LOCATION _Ft. Hood, TX REPORT NO. 432-115 PAGE 1 OF 1 MARKS Vehicle had just previously been through the "hird bath" and then parked on the ah rack. Later, when an attempted start was made the vehicle emitted large amounts of oke and flames out the exhaust. A restart attempt was made and the vehicle aborted the the same results (two gas over temp aborts). Troubleshooting revealed an accumulative water in the planum chamber and the ves-Pace ware also wet. The HP bleed tube was we the oil as was the exhaust and the engine intake. All components rotated freely. After moving the combustor can, minor thermal damage and was beginning to curl. The # 5 bearing a small also had thermal damage at the top of the scroll at the 6 c'clock position. a scupper drain also had thermal damage and was beginning to curl. The # 5 bearing avenge line inside the rear module was badly burned at the bottom. a visible thermocouple harnesses were also burned. Engine are nodule 85H097. Forward Module 85J075. AGB 85J068.	A CONTRACT OF A	1111						N	SOURCE	1st HAN		HAND D
DATE OF REPORT 25 Nov '85 LOCATION _Ft. Hood, TY REPORT NO. 432-115 PAGE 1 OF. REPORT NO. 40100 PAGE 1 OF. REPORT NO. 40000 PAGE 1 OF. REPORT NO. 40000 PAGE 1 OF. REPORT								11	and the base of			Service and the service of the servi
Little in the province of the end of the second the last two cooling real of the same results (two gas over temp aborts). Troubleshooting revealed an accumulation water in the planum chamber and the verice intake. All components rotated freely. After moving the combustor can. minor thermal damage was noted around the last two cooling relation. a scould also had thermal damage and was beginning to curl. The # 5 bearing average line inside the rear module was badly burned at the bottom. ACTION for work of the depot. The HNB and ECU will be evacuated to the depot. The HNB and ECU will be the work of the depot. The HNB and ECU will be the work of the depot. The HNB and ECU will be the work of the depot. The HNB and ECU will be evacuated to the depot. The HNB and ECU will be the work of the depot. The HNB and ECU will be the work of the depot. The HNB and ECU will be the work of the depot. The HNB and ECU will be the work of the depot. The HNB and ECU will be the work of the depot. The HNB and ECU will be the work of the depot. The HNB and ECU will be the combustor for the depot. The HNB and ECU will be the depot.								II	TECH REP	S NAME	E.C. C	riffin
MARKS Vehicle had just previously been through the "bird bath" and then parked on the sh rack. Later, when an attempted start was made the vehicle emitted large amounts of oke and flames out the exhaust. A restart attempt was made and the vehicle aborted th the same results (two gas over temp aborts). Troubleshooting revealed an accumulat: water in the planum chamber and the Ves-Pace were also wet. The HP bleed tube was we th oil as was the exhaust and the engine intake. All components rotated freely. After moving the combustor can. minor thermal damage was noted around the last two cooling ri- a scroll also bed thermal damage at the top of the scroll at the 6 o'clock position. a scupper drain also had thermal damage and was beginning to curl. The # 5 bearing avenge line inside the rear module was badly burned at the bottom. a visible thermocouple harnesses were also burned. Engine ll be evacuated to the depot. The HNB and ECU will be acked on DSEBTS. Other Modules making up this engine area ar Module 85H097. Forward Module 85U075. AGB 851068.						Sector Sector		121	DATE OF R	EPORT _	CO Nov	and the owner of the local division of the l
MARKS Vehicle had just previously been through the "hird bath" and then parked on the sh rack. Leter, when an attempted start was made the vehicle emitted large amounts of oke and flames out the exhaust. A restart attempt was made and the vehicle aborted th the same results (two gas over temp aborts). Troubleshooting revealed an accumulat water in the plenum chamber and the Ves-Pace were also wet. The HP bleed tube was we th oil as was the exhaust and the engine intake. All components rotated freely. After moving the combustor can, minor thermal damage was noted around the last two cooling re- a scroll also had thermal damage at the top of the scroll at the 6 o'clock position. a scupper drain also had thermal damage and was beginning to curl. The # 5 bearing avenge line inside the rear module was badly burned at the bottom. a visible thermocouple harnesses were also burned. Engine It be evacuated to the depot. The HNB and ECU will be acked on DSESTS. Other Modules making up this engine are: ar Module 85H097. Forward Module 85J075. AGB 85J068.		<u></u>		10 A 10 A							HOOD T	
MARKS Vehicle had just previously been through the "hird bath" and then parked on the ab rack. Later, when an attempted start was made the vehicle emitted large amounts of oke and flames out the exhaust. A restart attempt was made and the vehicle aborted th the same results (two gas over temp aborts). Troubleshooting revealed an accumulat water in the plenum chamber and the Vee-Pace were also wet. The HP bleed tube was we th oil as was the exhaust and the engine intake. All components rotated freely. After moving the combustor can, minor thermal damage was noted around the last two cooling re- a scroll also had thermal damage at the top of the scroll at the 6 o'clock position. a scupper drain also had thermal damage and was beginning to curl. The # 5 bearing avenge line inside the rear module was badly burned at the bottom. ACTION is executed to the depot. The HNB and ECU will be the evacuated to the depot. The HNB and ECU will be the evacuated to the depot. The HNB and ECU will be the was badly of the age are in the bottom. Backed on DSENTS. Other Modules making up this engine are: the Module 85H097, Forward Module 85J075, AGB 85J068.								111	LUCATION		mann, I	
an rank. Later, when an attempted start was made the vehicle emitted large amounts of oke and flames out the exhaust. A restart attempt was made and the vehicle aborted th the same results (two gas over temp aborts). Troubleshooting revealed an accumulat: water in the plenum chamber and the Vee-Pace were also wet. The HP bleed tube was we th oil as was the exhaust and the engine intake. All components rotated freely. After moving the combustor can, minor thermal damage was noted around the last two cooling ri- a scroll also had thermal damage at the top of the scroll at the 6 o'clock position. a scupper drain also had thermal damage and was beginning to curl. The # 5 bearing avenge line inside the rear module was badly burned at the bottom. Action be evacuated to the depot. The HNB and ECU will be ecked on DSESTS. Other Modules making up this engine are: If Module 85H097, Forward Module 85J075, AGE 85J068.		<u></u>				<u></u>		L.				
an rack. Later, when an attempted start was made the vehicle emitted large amounts of one and flames out the exhaust. A restart attempt was made and the vehicle aborted th the same results (two gas over temp aborts). Troubleshooting revealed an accumulat water in the plenum chamber and the Vee-Pace were also wet. The HP bleed tube was we th oil as was the exhaust and the engine intake. All components rotated freely. After avoing the combustor can, minor thermal damage was noted around the last two cooling re- a acroll also had thermal damage at the top of the scroll at the 6 o'clock position. Is scupper drain also had thermal damage and was beginning to curl. The # 5 bearing avenge line inside the rear module was badly burned at the bottom. Is visible thermocouple harnesses were also burned. Engine is evacuated to the depot. The HNB and ECU will be ocked on DSESTS. Other Modules making up this engine are: If Module 85H097, Forward Module 85J075, AGE 85J068.		<u></u>	<u></u>					-		0. 432-	115 PAG	EL OF
the same results (two gas over temp aborts). Troubleshooting revealed an accumulate water in the plenum chamber and the Vas-Pace were also wet. The HP bleed tube was we th oil as was the exhaust and the engine intake. All components rotated freely. After moving the combustor can, minor thermal damage was noted around the last two cooling ri- a scroll also had thermal damage at the top of the scroll at the 6 o'clock position. Is scupper drain also had thermal damage and was beginning to curl. The # 5 bearing avenge line inside the rear module was badly burned at the bottom. Is visible thermocouple harnesses were also burned. Engine is evacuated to the depot. The HNB and ECU will be becked on DSESTS. Other Modules making up this engine are: If Module 85H097, Forward Module 85J075, AGE 85J068.	MARKS Vehicle	bad fust	L		1 1 1 1 1 1 1 1 1		<u>+ </u>	-		0. 432-	115 PAG	EL OF
the and flames out the exhaust. A restart attempt was made and the vehicle aborted the same results (two gas over temp aborts). Troubleshooting revealed an accumulat water in the plenum chamber and the Vas-Pacs were also wet. The HP bleed tube was we then the combustor can. minor thermal damage was noted around the last two cooling re- a scroll also had thermal damage at the top of the scroll at the 6 o'clock position. a scroll also had thermal damage and was beginning to curl. The # 5 bearing avenge line inside the rear module was badly burned at the bottom. A visible thermocouple harnesses were also burned. Engine is evacuated to the depot. The HNB and ECU will be beked on DSESTS. Other Modules making up this engine are: If Module 85H097, Forward Module 85J075, AGB 85J068.	MARKS Vehicle	bad just	t previ	ously b	een th	rough	1.1.1 the "	1-1	REPORT N	0. <u>432-</u>	115 PAG	BE 1 OF
th the same results (two gas over temp aborts). Troubleshooting revealed an accumulat water in the plenum chamber and the Vec-Pace were also wet. The HP bleed tube was we th oil as was the exhaust and the engine intake. All components rotated freely. After moving the combustor can. minor thermal damage was noted around the last two cooling r a scroll also had thermal damage at the top of the scroll at the 6 o'clock position. a scroll also had thermal damage and was beginning to curl. The # 5 bearing avenge line inside the rear module was badly burned at the bottom. Action be evacuated to the depot. The HNB and ECU will be ucked on DSESTS. Other Modules making up this engine are: ar Module 85H097. Forward Module 85J075. AGB 85J068.		ar man	an att	Lamptad	start	Was ma	de th	bird e vi	REPORT N	0. <u>432-</u> d then tted 1	Darked	on the
th oil as was the exhaust and the engine intake. All components rotated freely. After noving the combustor can. minor thermal damage was noted around the last two cooling re- a scroll also had thermal damage at the top of the scroll at the 6 o'clock position. A scroll also had thermal damage at was beginning to curl. The # 5 bearing avenge line inside the rear module was badly burned at the bottom. A visible thermocouple harnesses were also burned. Engine I be evacuated to the depot. The HNB and ECU will be becked on DSESTS. Other Modules making up this engine are: I'm Module 85H097. Forward Module 85J075. AGE 85J068.	oke and flame	out the	e exhau	st. A	start restar	t atte	de th		REPORT N 1 bath" an 2 bicle emi made and t	d then tted L	Darked	on the ounts of
a scroll also had thermal damage at the top of the scroll at the 6 o'clock position. a scroll also had thermal damage at the top of the scroll at the 6 o'clock position. a scroll also had thermal damage at the top of the scroll at the 6 o'clock position. a scroll also had thermal damage and was beginning to curl. The # 5 bearing avenge line inside the rear module was badly burned at the bottom. a visible thermocouple harnesses were also burned. Engine a scroll be evacuated to the depot. The HNB and ECU will be acked on DSEETS. Other Modules making up this engine are: ar Module 85H097. Forward Module 85J075. AGE 85J068.	oke and flame	out the	e exhau	st. A	start restar	t atte	de th		REPORT N 1 bath" an 2 bicle emi made and t	d then tted L	Darked	on the ounts of
a scroll also had thermal damage at the top of the scroll at the 6 o'clock position. a scroll also had thermal damage at the top of the scroll at the 6 o'clock position. avenge line inside the rear module was badly burned at the bottom. avenge line inside the rear module was badly burned at the bottom. avenge line inside the rear module was badly burned at the bottom. avenge line inside the rear module was badly burned. Engine bottom. ACTION action for ar Module 85H097. Forward Module 85J075. AGB 85J068.	oke and flame th the same r	esults (e exhau two gas	st. A	emp ab	t atte	de th mpt w Tro		REPORT N hath" an hicle emi made and t	d then tted 1 he veh	parked parked arge and icle abo	on the ounts of orted
a scroll also had thermal damage at the top of the scroll at the 6 o'clock position. a scroll also had thermal damage at the top of the scroll at the 6 o'clock position. avenge line inside the rear module was badly burned at the bottom. avenge line inside the rear module was badly burned at the bottom. avenge line inside the rear module was badly burned at the bottom. avenge line inside the rear module was badly burned. Engine bottom. ACTION action for ar Module 85H097. Forward Module 85J075. AGB 85J068.	oke and flame th the same r water in the	esults (e exhau two gas chamber	st. A	start restar emp ab	t atte	de th mpt w Tro	e vi	REPORT N beth" an shicle emi made and t schooting	d then tted 1 he veh reveal	parked parked arge and tole abo	on the ounts of orted cumulat
a scroll also had thermal damage at the top of the scroll at the 6 o'clock position. a scupper drain also had thermal damage and was beginning to curl. The # 5 bearing avenge line inside the rear module was badly burned at the bottom. a visible thermocouple harnesses were also burned. Engine ll be evacuated to the depot. The HNB and ECU will be acked on DSESTS. Other Modules making up this engine are: ar Module 85H097. Forward Module 85J075. AGB 85J068.	th the same r water in the	e out the results (plenum the exh	e exhau two gas chamber aust ar	over t	start restar emp ab e Vee- ngine	t atte orts). Pacs w intake	de th mpt w Tro era a	bird e vi as i ublo lao	REPORT No. bath" and bhicle emi made and t eshooting wet. The	i then tted <u>L</u> he veh reveal HP blo	parked arge and icle abc ed an ac	on the ounts of orted ocumulat:
avenge line inside the rear module was badly burned at the bottom. e visible thermocouple harnesses were also burned. Engine ll be evacuated to the depot. The HNB and ECU will be acked on DSENTS. Other Modules making up this engine are: ar Module 85H097. Forward Module 85H075. AGB 85H068.	th the same r water in the th oil as was moving the co	plenum the exh mbustor	e exhau two gas chamber aust ar Can. mi	a over t a over t and the nor the	start restar emp ab a Vac- ngine rmal d	t atte orts). Pacs w intake	de th mpt w Tro ere a Al	bird e vo as i ublo lao l co	REPORT No. hath" and shicle emi made and t eshooting wet. The omponents around t	d then tted 1 he veh reveal HP blo rotated	parked arge and icle abd ad an ac ad tube i freely t two co	on the ounts of orted coumulat: was we was we of After
e visible thermocouple harnesses were also burned. Engine ll be evacuated to the depot. The HNB and ECU will be acked on DSESTS. Other Modules making up this engine are: ACTION FOR ar Module 85H097. Forward Module 85J075. AGE 85J068.	oke and flame th the same r water in the th oil as was moving the co	plenum mbustor (e exhau two gas chamber aust an Can. mi	and the entropy of the second	start restar emp ab e Vee- ngine rmal du the t	t atte orts). Pacs w intake	Tro Tro Al	birde vo	REPORT N hath" an high emi nade and t eshooting wet. The omponents around t	d then tted 1 he veh reveal HP blo rotates	parked arge and icle abd ad an ac ad tube i freely t two co	on the ounts of orted coumulat: was we was we of After
evisible thermocouple harnesses were also burned. Engine ll be evacuated to the depot. The HNB and ECU will be acked on DSESTS. Other Modules making up this engine are: THANNON FOR THANNON FOR THANK ON FOR	th the same r water in the th oil as was moving the co	plenum mbustor (e exhau two gas chamber aust an Can. mi	and the entropy of the second	start restar emp ab e Vee- ngine rmal du the t	t atte orts). Pacs w intake	Tro Tro Al	birde vo	REPORT N hath" an high emi nade and t eshooting wet. The omponents around t	d then tted 1 he veh reveal HP blo rotates	parked arge and icle abo ed an ac and tube i freely t two co pok post	on the ounts of orted coumulat: was we r. After poling r: tion.
ecked on DSESTS. Other Modules making up this engine are: THANNON FOR ar Module 85H097, Forward Module 85J075, AGE 85J068.	oke and flame th the same r water in the th oil as was moving the co a scroll also a scupper dra	plenum the exh mbustor (had then in also }	e exhau two gas chamber aust an Can. mi rmal da had the	and the entroy the the the the the entropy of the the entropy of the the entropy of the the entropy of the	start restar emp ab a Vac- ngine rmal d the t	t atte orts). Pacs w intake amage op of nd was	de th mpt w Tro ers s Al Mas n the s	bird e vi as i ublo lao loc oted	REPORT N bath" an bhicle emi made and t eshooting wet. The omponents around t l at the	i then tted 1 he veh reveal HP blo rotates he las	parked arge and icle abo ed an ac and tube i freely t two co pok post	on the ounts of orted coumulat: was we r. After poling r: tion.
ar Module 85H097, Forward Module 85J075, AGE 85J068.	th the same r water in the th oil as was moving the co a scroll also e scupper dra avenge line in	bad then in also i	e exhan two gas chamber aust an can. mi rmal da had the s rear	and the entropy day	start restar emp ab e Vea- ngine rmal d the t mage a was bac	t atte orts). Paca w intake anage op of nd was dly bu	de th <u>mpt</u> w <u>Tro</u> <u>ers</u> a <u>Al</u> was n the si <u>begin</u> cned	bird e vi as i ublo lao loc oted	REPORT N bath" an bhicle emi made and t eshooting wet. The omponents around t l at the	i then tted 1 he veh reveal HP blo rotates he las	parked arge and icle abo ed an ac and tube i freely t two co pok post	on the ounts of orted coumulat: was we r. After poling r: tion.
ar Module 85H097, Forward Module 85J075, AGE 85J068.	th the same r water in the th oil as was moving the co e scroll also e scupper dra avenge line in e visible the	bad ther in also }	e exhan two gas chamber aust an Cen. mi rmal da had the e rear	and the entropy of th	start restar emp ab e Vee- ngine rmal d the t mage a was ba	t atte orts). Paca w intake amage op of nd was dly burn	de th <u>npt w</u> <u>Tro</u> ers a <u>A1</u> was n the s <u>begin</u> rned a	bird e vi as i uble lao lao oted arol nnir at t	REPORT N hicle emi made and t shooting wet. The pmponents around t l at the be to curl the bottom	i then tted 1 he veh reveal HP blo rotates he las	parked arge and icle abo ed an ac and tube i freely t two co pok post	on the ounts of orted cumulation was wet r. After poling ri- tion. ring
ar Module 85H097, Forward Module 85J075, AGB 85J068.	th the same r water in the th oil as was moving the co e scroll also e scupper dra avenge line in e visible the	bad ther in also }	e exhan two gas chamber aust an Cen. mi rmal da had the e rear	and the entropy of th	start restar emp ab e Vee- ngine rmal d the t mage a was ba	t atte orts). Paca w intake amage op of nd was dly burn	de th <u>npt w</u> <u>Tro</u> ers a <u>A1</u> was n the s <u>begin</u> rned a	bird e vi as i uble lao lao oted arol nnir at t	REPORT N hicle emi made and t shooting wet. The pmponents around t l at the be to curl the bottom	i then tted 1 he veh reveal HP blo rotates he las	parked parked arge and icle abd ed an ac ed tube i freely t two co pok post # 5 bea	on the ounts of orted ocumulation was well to was well of the second tion. ring ACTION
EXCELLENCE	th the same r water in the th oil as was moving the co e scroll also e scupper dra avenge line in e visible the ll be evacuate	bad then moustor (had then in also h nside the rmocouple ed to the	an all a exhau two gas chamber aust an Can. mi rmal da had the s rear s harne s dapot	and the end th	atart restar emp ab e Vee- ngine rmal d the t mage a was bad re also	t atte orts). Paca y intake amage op of op of dly burne dly burne dly burne dly burne	the the second s	bird e vi as i uble lao loc oted arol nnir at t Engi	REPORT N hath" an ahicle emi made and t eshooting wet. The omponents around t lat the bottom he bottom	i then tted 1 he veh reveal HP blo rotates he las	parked parked arge and icle abd ed an ac ed tube i freely t two co pok post # 5 bea	on the ounts of orted ocumulat: was we onling r: tion. ring ACTION
	oke and flame th the same r water in the th oil as was moving the co a scroll also e scupper dra avenge line in e visible the ll be evacuate ecked on DSES	the exhibit of the ex	an all a exhau two gas chamber aust an <u>can. mi</u> rmal da had the s rear s harne s depot	and the and the and the and the anor the mage at module sses we to The les make	start restar emp ab e Ves- ngine rmal d the t the t was bas rs also HNB and	t atte orts). Paca w intake amage op of ally burn o burn a ECU u	de th mpt w Tro era a Al was n the a begin rned a sd. 1 vill 1	bird e vi as i uble lao loc oted arol nnir at t Engi	REPORT N hath" an ahicle emi made and t eshooting wet. The omponents around t lat the bottom he bottom	i then tted 1 he veh reveal HP blo rotates he las	115 PAC parked arge and icle abc ed an ac ad tube i freely t two co pok posi # 5 bea	on the ounts of orted coumulat: was we of After oling ri- tion. ring ACTION FOR

STRATFORD CONN.

١.

